FIBER

LASER SENSORS

SENSORS MICRO PHOTOELECTRIC SENSORS AREA SENSORS

SAFETY COMPONENTS PRESSURE SENSORS INDUCTIVE PROXIMIT SENSORS

SENSOR WIRE-SAVING SYSTEMS MEASUREMENT

SENSORS STATIC CONTROL DEVICES

> LASER MARKERS

SENSORS

PHOTOELECTRIC

# LED Type Wafer Alignment Sensor ERIES

Related Information

General terms and conditions...... P.1 General precautions ...... P.986~

Sensor selection guide .....P.11~ / P.727~

CE




# The use of a safe LED light beam now allows for high precision detection with a resolution of 30 µm 1.181 mil

## No safety measures are required at all

As a safe red LED is used as the light source, there is no need for time-consuming safety measures. The protective covers usually required when using laser beams are not needed, and FDA approval is not required in order to use this sensor in the US.

## Easy installation

This unit utilizes a one-touch connector to connect the sensor head to the controller. The amount of wiring is therefore minimized, resulting in easy maintenance.

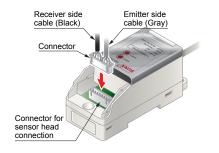

## Low current consumption of 70 mA or less

The HD-T1 series has a maximum current consumption of only 70 mA, for both the sensor head and the controller. The current consumption is almost as low as that of photoelectric sensors.

## High resolution of 30 µm 1.181 mil


Although the HD-T1 series uses a red LED for its light source, it has the same high level of performance as laser sensors, thus enabling high precision detection.

## No need for beam axis alignment


As both the receiver and the emitter are integrated into a single unit, there is no need to perform any troublesome alignment of the beam axis. In addition, as the HD-T1 series can perform its detection function over a broad area - with both a sensing range and a sensing width of 30 mm 1.181 in, this unit can be utilized for sensing wafers of many different sizes.

## Adjustment functions for both span and shift have been incorporated

In addition to the span adjustment function, a convenient shift adjustment function has also been incorporated into the analog output (1 to 5 V). The shift adjustment function allows the analog voltage to be shifted by up to ±0.5 V.

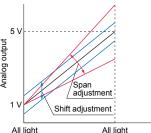

Amount of the light received All light interrupted state All light received state

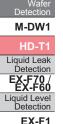

Selection Guide



FIBER SENSORS

LASER SENSORS

PHOTO-ELECTRIC SENSORS MICRO PHOTO-ELECTRIC SENSORS

AREA SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC CONTROL DEVICES

LASER MARKERS

Selection Guide Wat Det M-DW1

## APPLICATIONS

Detecting wafer eccentricities or notches



# ORDER GUIDE

## Sensor head

Appearance	Sensing range	Sensing width	Model No.
	30 mm 1.181 in (fixed) (Note)	30 mm 1.181 in	HD-T1030

Note: The value is in a state that the sensor is mounted on the mounting base at the time of factory shipment.

### Controller

Appearance	Model No.	Output	Make sure to use the sensor head and the controller together as a set.
	HD-T1C	Analog voltage • Output voltage: 1 to 5 V	

## SPECIFICATIONS

## Sensor head

Ser	isor head		Liquid Leak Detection
Model No.		HD-T1030	
Applicable controller		HD-T1C	
Sensing width		30 mm 1.181 in (Linearity is specified at 28 mm 1.102 in width.)	Color Mark Detection
Sensing range		30 mm 1.181 in (fixed) (Note 2)	LX-100
	Pollution degree	3 (Industrial environment)	FZ-10
Environmental resistance	Ambient temperature	0 to +40 °C +32 to +104 °F (No dew condensation), Storage: -20 to +55 °C -4 to +131 °F	Small / Slim Object Detection
	Ambient humidity	35 to 85 % RH, Storage: 35 to 85 % RH	NA1-11
	Ambient illuminance	Incandescent light: 3,000 & at the light-receiving face, Fluorescent light: 3,000 & at the light-receiving face	
	Voltage withstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure	GD
	Insulation resistance	20 M $\Omega$ , or more, with 250 V DC megger between all supply terminals connected together and enclosure	Other Products
	Vibration resistance	10 to 150 Hz frequency, 0.75 mm 0.030 in amplitude in X, Y and Z directions for two hours each	
	Shock resistance	490 m/s <sup>2</sup> acceleration (50 G approx.) in X, Y and Z directions for three times each	
Em	tting element	Red LED (Peak emission wavelength: 650 nm 0.026 mil)	
Receiving element		Photodiode	
Material		Enclosure: PEI, Front cover: Glass, Mounting base: Aluminum	
Cable		Heat-resistant PVC cable, 0.5 m 1.640 ft long, with a connector at the end	
Weight		Net weight: 150 g approx.	
	4) ) 4(1		

Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +20 °C +68 °F. 2) The value is in a state that the sensor is mounted on the mounting base at the time of factory shipment.

FIBER SENSORS

M-DW1

Liquid Leak Detection

EX-F70 / EX-F60

De

## **SPECIFICATIONS**

#### Controller

LASER SENSORS	Cor	Controller		
PHOTO- ELECTRIC SENSORS	RIC IRS Item		HD-T1C	
MICRO PHOTO- ELECTRIC SENSORS	R0 T0- Applicable sensor head		HD-T1030	
AREA	Supply voltage		24 V DC ± 10 % Ripple P-P 10 % or less	
SENSORS			70 mA or less (Including sensor head)	
SAFETY COMPONENTS PRESSURE			<ul> <li>Analog voltage</li> <li>Output voltage: 1 ± 0.5 V (all light interrupted) to 5 ± 0.5 V (all light received)</li> <li>Output impedance: 75 Ω</li> </ul>	
SENSORS		Response time	0.5 ms or less (8 V/ms or more)	
INDUCTIVE PROXIMITY		Resolution	30 µm 1.181 mil (Note 2)	
SENSORS PARTICULAR USE SENSORS		Linearity	±1.0 % F.S. (at 28 mm 1.102 in sensing width of the sensing center) (Note 3)	
		Temperature characteristics	±0.1 % F.S./°C (at 24 ± 2 °C 75.2 ± 35.6 °F) (Note 3)	
SENSOR	Span adjustment function		Span of the analog output voltage is adjusted. 15-turn endless adjuster	
OPTIONS	Shift adjustment function		Offset of the analog output voltage is adjusted. 15-turn endless adjuster	
WIRE- SAVING SYSTEMS	Warming-up period		30 min. or more	
MEASURE-		Pollution degree	3 (Industrial environment)	
MENT SENSORS	nce	Ambient temperature	0 to +40 °C +32 to +104 °F (No dew condensation), Storage: -20 to +70 °C -4 to +158 °F	
STATIC CONTROL	Environmental resistance	Ambient humidity	35 to 85 % RH, Storage: 35 to 85 % RH	
DEVICES	alre	EMC	EN 61000-6-2, EN 61000-6-4	
LASER MARKERS	nent	Voltage withstandability	1,000 V AC for one min. between all supply terminals connected together and enclosure	
	ironr	Insulation resistance	20 M $\Omega$ , or more, with 250 V DC megger between all supply terminals connected together and enclosure	
	Env	Vibration resistance	10 to 150 Hz frequency, 0.75 mm 0.030 in amplitude in X, Y and Z directions for two hours each	
		Shock resistance	490 m/s <sup>2</sup> acceleration (50 G approx.) in X, Y and Z directions for three times each	
	Material		Enclosure: Heat-resistant ABS, Connector cover: Heat-resistant ABS, Adjuster cover: Polycarbonate	
	Cab	le	0.22 mm <sup>2</sup> 3-core heat-resistant PVC cable, 0.3 m 0.984 ft long	
	Cab	le extension	Extension up to total 3 m 9.843 ft is possible with 0.3 mm <sup>2</sup> , or more, heat-resistant PVC cable.	
Selection Guide			Net weight: 85 g approx.	
Wafer				


Notes: 1) Where measurement conditions have not been specified precisely, the conditions used were an ambient temperature of +20 °C +68 °F.

2) Resolution refers to the peak to peak distance conversion value of analog output (in the frequency band below 20 MHz).

3) This is the representative example of measurement with a combination of sensor head and controller.

# I/O CIRCUIT AND WIRING DIAGRAMS (Controller)


#### I/O circuit diagram

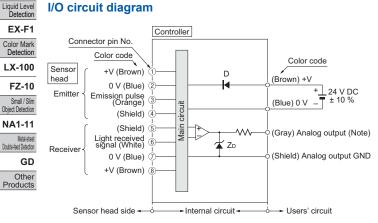

Note: Analog output does not incorporate a short-circuit protection circuit. Do not connect it directly to a power supply or a capacity load.

Symbols ... D : Reverse supply polarity protection diode ZD: Surge absorption zener diode

#### **Terminal arrangement**

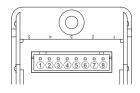

Terminal No.	Description		
1	+V		
2	0 V	Emitter side	
3	Emission pulse		
4	Shield		
5	Shield		
6	Light received signal	Receiver side	
1	0 V		
8	+V		

FIRER SENSORS

LASER SENSORS

PHOTO-ELECTRIC

SENSORS

MICRO PHOTO

ARFA

PHOTO-ELECTRIC SENSORS

SENSORS

SAFETY COMPONENTS

PRESSURE SENSORS

INDUCTIVE PROXIMITY SENSORS

SENSOR OPTIONS

WIRE-SAVING SYSTEMS

MEASURE-MENT SENSORS

STATIC

CONTROL DEVICES

LASER MARKERS

Selection Guide

M-DW1

# PRECAUTIONS FOR PROPER USE

· Never use this product as a sensing device for personnel protection.




· In case of using sensing devices for personnel protection, use products which meet laws and standards, such as OSHA, ANSI or IEC etc., for personnel protection applicable in each region or country.

· Make sure to use the sensor head and the controller together as a set.

#### Mounting

#### Sensor head

- · Mount the sensor head using 2 pcs. M4 hexagon-sockethead bolts (please arrange separately) with a tightening torque of 0.5 N·m or less.
- Do not remove the screws fixing the emitter / receiver and the mounting base. If removed, the output value will change.
- · Do not fix with the screws, using the mounting hole on the side of emitter / receiver.

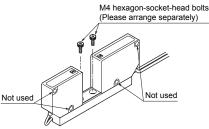


#### Controller

HD-T1030

#### <In case of using DIN rail>

- ①Fit the front part of the mounting section of the unit on the 35 mm 1.378 in width DIN rail, pressing the stopper towards the arrow (the stopper is locked) shown in the right figure.
- <sup>②</sup>Press down the rear part of the mounting section of the unit on the 35 mm 1.378 in width DIN rail to fit it.
- \* For removal, insert a flat-bladed screwdriver into the groove of the stopper and pull the handle backwards.

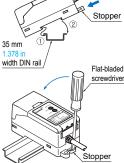


Sensor head

Refer to p.986~ for general precautions.

#### <In case of using screws>

· Mount using M4 pan head screws with a tightening torque of 1.2 N·m or less.

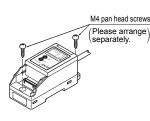


#### Wiring

- · Analog output of controller does not incorporate a shortcircuit protection circuit. Do not connect it directly to a power supply or a capacity load .
- · Care should be taken that static electricity is not applied to the connector during wiring. It may damage the product.
- Take care that wrong wiring will damage the product.
- Cable extension is possible up to total 3 m 9.843 ft with 0.3 mm<sup>2</sup>, or more, cable. Note that the cable length of the sensor head cannot be changed.
- · Do not apply stress such as forced bending and pulling to the cable joint.
- · Make sure to use an isolation transformer for the DC power supply. If an autotransformer (single winding transformer) is used, this product or the power supply may get damaged.
- In case a surge is generated in the used power supply, connect a surge absorber to the supply and absorb the surge.

#### Others

DIMENSIONS (Unit: mm in) The CAD data in the dimensions can be downloaded from the SUNX website: http://www.sunx.com


- Do not use during the initial transient time (0.5 sec. approx.) after the power supply is switched on.
- · This product outputs according to the amount of LED light received. Optical power varies between the center and the periphery of sensing range, and note that dimensional accuracy cannot be assured.
- Do not allow any water, oil, fingerprints, etc., which may refract light, or dust, dirt, etc., which may block light, to stick to the emitting / receiving surfaces of the sensor head. In case they are present, wipe them with a clean, dust-free soft cloth or lens paper.
- · If the sensing object is specular or transparent object, note that accurate measurement may not be possible.
- Liquid Leak EX-F70 EX-F60 Liquid Level Detection

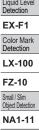








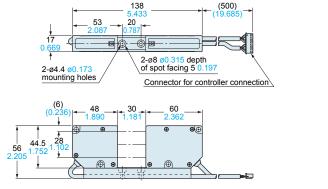

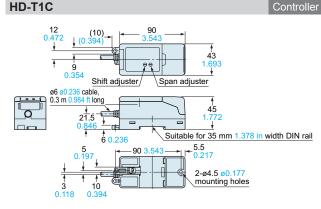

7.5

47.3

<When the cover is removed>

Connector for sensor head connection

